Richmond LPS Alert - Reliability







I-ERM NLI #: 29547

Location:

TKN Water Wash for E-550, Richmond Refinery

Contact Information:

Ron Post CTN 242-5170 RonPost@chevron.com

Edwards Valve used for Water Wash:



Edwards Valve (arrow points to stripped bonnet/yoke bushing)



Always remember to do your LPSA – because we care about you!

Incident Description:


On January 13, 2012, after completing a water wash of the E-550 Recycle-Effluent exchanger at the TKN plant, a 3-inch Edwards angle valve malfunctioned while the operator was closing it. The valve was almost closed when the threads of the bonnet/yoke bushing stripped out and allowed the valve to suddenly "snap" to a full-open position under system pressure of 2600 psig. This particular Edwards valve was being used to throttle wash water flow rate to the exchanger and is used about twice a week. A second Edwards valve is already present in this system and was used to complete the isolation of water wash flow.

Immediate Actions Taken:

- Design engineering assessed the Edwards valve in its back-seated condition to confirm the abrupt stem movement did not disturb the packing-to-stem seal.
- 2) Inspections performed radiography and did not observe any obvious deficiencies of the valve internals.
- 3) An investigation is currently in progress. During the next planned shutdown, this valves will be disassembled for a thorough inspection.

Considerations:

- 1. This incident highlights the critical importance of following Chevron Engineering Standards.
- 2. Persuaders should not be used to apply excessive force on Edwards angle valves to avoid bending the stem or damaging the yoke bushing.

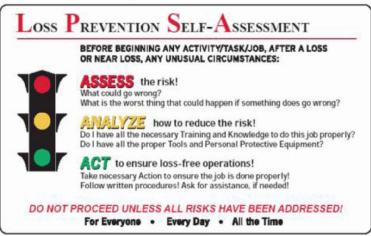

This document is intended for company workforce only. Nothing herein should be construed as a legal determination of causation or responsibility. The company makes no representations or warranties, express or implied, about the thoroughness, accuracy, or suitability of use by others of any of the information contained herein